


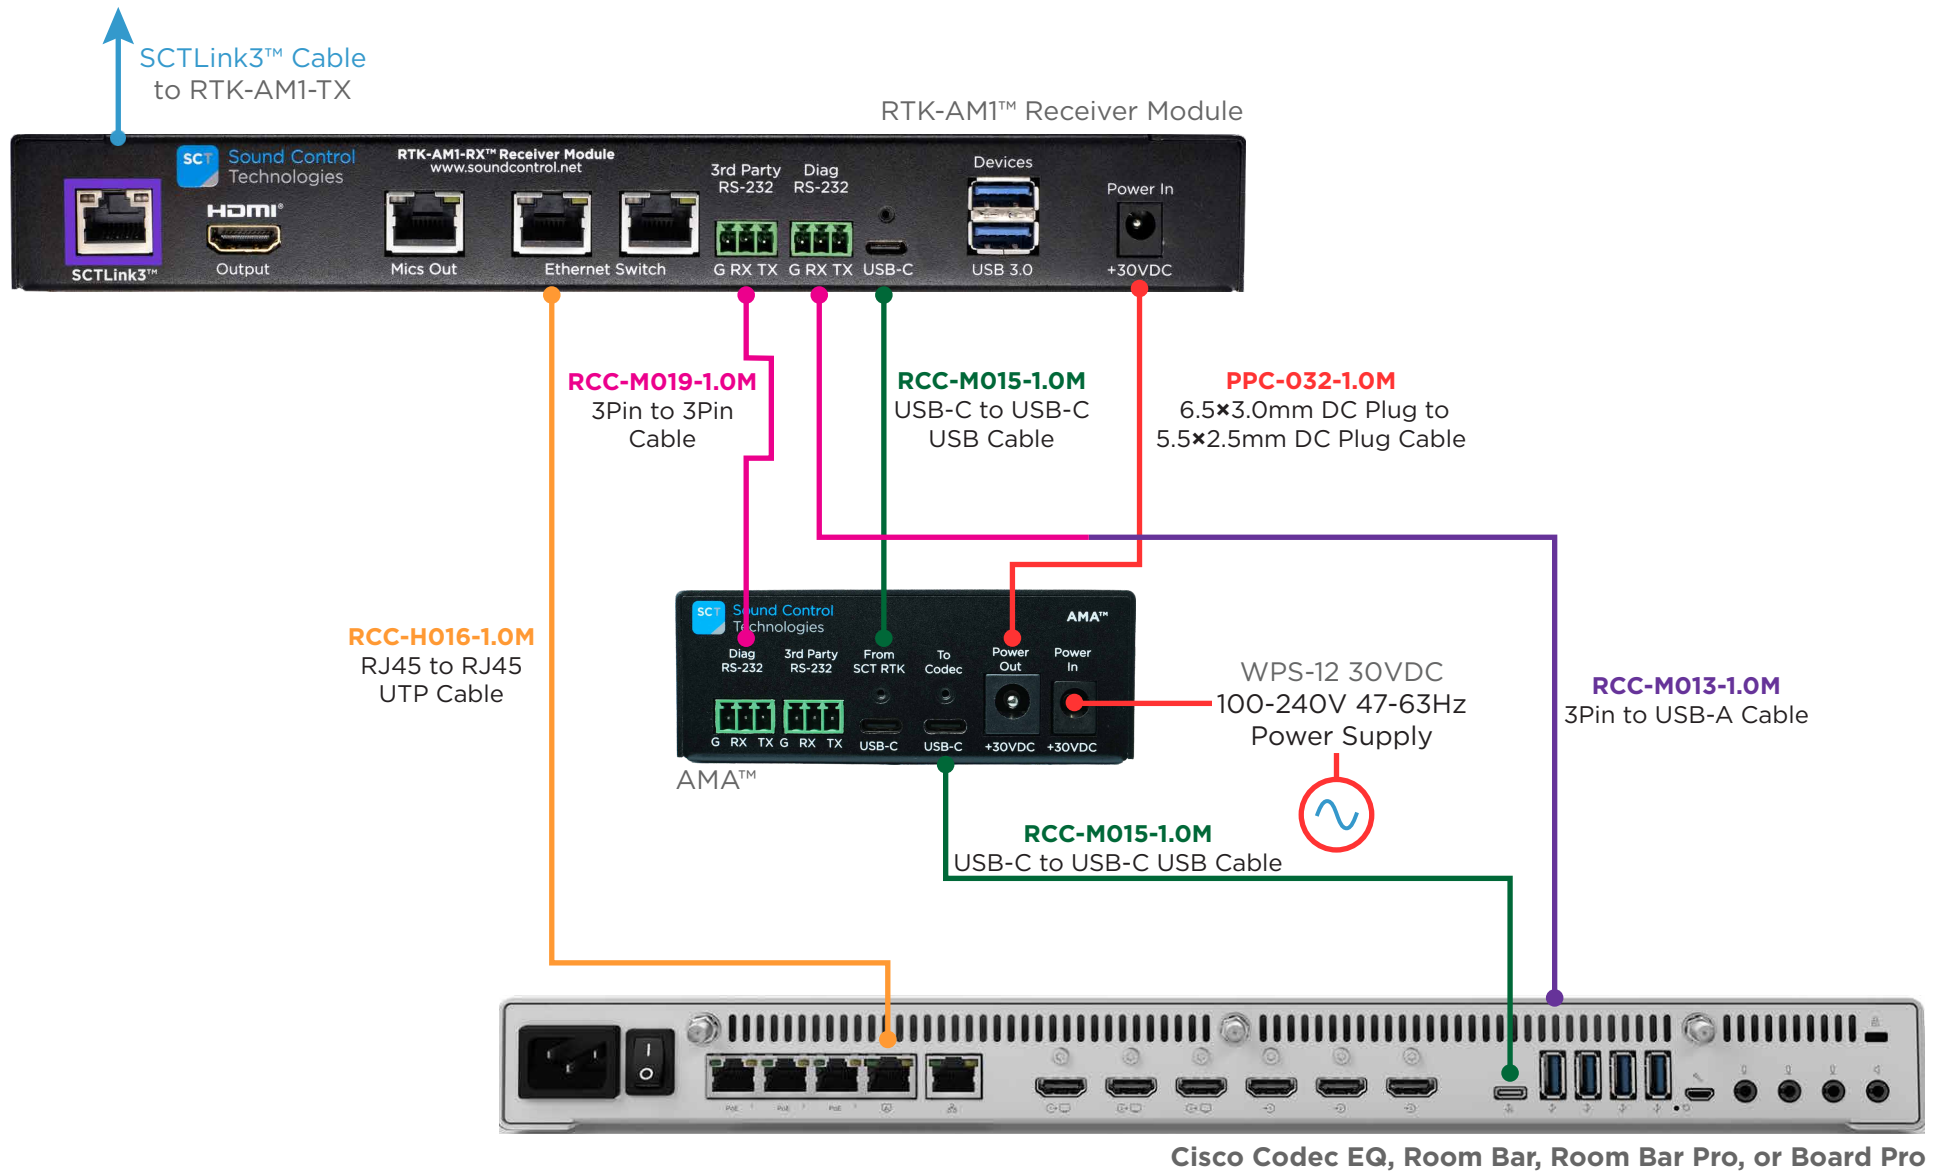

Note: DIP switch position 1 on the Receiver must be in the on position to enable Cisco communications.